



Firmware for ICS-G7752A Series Release Notes

Version: v5.8	Build: 21081910
Release Date: Sep 15, 2021	

Applicable Products

N/A

Supported Operating Systems

N/A

New Features

- Supports Interface Tracking, Ping Tracking, and Logic Tracking.

Enhancements

- The CPU utilization now displays a percentage instead of "Normal" and "Busy".
- Firmware upgrade processing status is displayed.
- Email addresses can contain up to 39 characters.
- Email Mail Servers can contain up to 39 characters.
- Enhanced SSH with secure key exchange algorithm, Diffie-Hellman Group 14.
- Improved random distribution of TCP Initial Sequence Number (ISN) values.
- Added an additional encryption option and command to the web UI and CLI.

Bugs Fixed

- [MSRV-2017-002][CVE-2019-6563] Predictable Session ID: Supports random salt to prevent session prediction attack of HTTP/HTTPS.
- [MSRV-2017-003][CVE-2019-6526] Encryption of sensitive data is missing: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2017-004][CVE-2019-6524] Improper restriction of excessive authentication attempts: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2017-005][CVE-2019-6559] Resource exhaustion: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2019-006] Denial of Service by PROFINET DCE-RPC Endpoint discovery packets.
- The device would restart due to memory leak during the Nmap (a freeware that can scan the available ports) scanning test.
- RSTP Port Status error with Modbus TCP.
- Trunk port was not shown correctly in the LLDP table.
- The head switch of Turbo Chain was blocked when connecting to a Cisco switch.
- SNMP v3 memory leak.
- The device rebooted when performing a Nessus basic scan.
- MAC authentication bypass with RADIUS re-authentication.
- When SNMP pooled every 10 seconds, the system would perform a cold start after 25 minutes.
- The LLDP Table hung up in a serial console.
- Packet flooding from MGMT VLAN to redundancy port PVID VLAN.
- CERT could not be imported.
- Error with Turbo Ring v2 and port trunk LLDP display, recovery time and log miswrite.
- Relay warning did not work properly after the system rebooted.
- RSTP was not activated correctly through the configuration file import.
- Incorrect value for IGMP Query Interval on the exported configuration file.



- Logging into the web console failed if authentication with local RADIUS and account lockout were both enabled at the same time.
- Turbo Ring v2 looped when too many slaves in the ring were powered on at the same time.
- Switch automatically performed a cold start when receiving specific SNMPv3 packets.
- [CRM #200811300717] If a username had a capitalized letter then the user would not be able to log in using Menu mode.
- [CRM #190726273178] Unauthorized 802.1x devices could receive multicast and broadcast packets.
- [CRM #210115312454] Trap Server Host Name cannot be set via web GUI.
- [CRM #201019305310] Incorrect SNMPv3 msgAuthoritativeEngineBoots behavior that the value will not count up after switch reboot.
- [CRM #200702298391] The relay trigger function by port traffic overload does not work.

Changes

- The IEEE 802.1x traffic enablement method has changed from MAC-based to port-based.
- The length of the 802.1x username is increased from 32 bytes to 64 bytes.

Notes

- MSRV is Moxa's internal security vulnerability tracking ID.



Version: v5.6	Build: Build_18112619
Release Date: Jan 18, 2019	

Applicable Products

ICS-G7752A Series

Supported Operating Systems

N/A

New Features

N/A

Enhancements

- Web GUI support for web browser Chrome 65.0

Bugs Fixed

- Fix abnormal display of packet counter in the web GUI

Changes

N/A

Notes

N/A



Version: v5.4	Build: Build_17081010
Release Date: Sep 04, 2017	

Applicable Products

ICS-G7752A-4XG-HV-HV

Supported Operating Systems

N/A

New Features

- System Notification: Definable Successful/Failed login notifications.
- Password Policy: Password Strength can be set.
- Account Lockout Policy: Failure Threshold and Lockout Time can be set.
- Log Management: Full log handling.
- Remote Access Interface Enable/Disable.
- Configuration Encryption with password.
- Support SSL certification import.
- Support MAC Authentication Bypass via RADIUS authentication.
- MAC Address Access Control List or MAC Address filtering.
- Protect against MAC Flooding Attack by MAC address sticky.
- NTP authentication to prevent NTP DDoS attack.
- Login Authentication: Support primary & backup database servers (RADIUS/TACACS+/Local Account).
- Login Authentication via RADIUS Server: Support Challenge Handshake Authentication Protocol (CHAP) Authentication Mechanism.
- RADIUS Authentication: Support EAP-MSCHAPv2 (For Windows7).
- MXview Security View Feature Support* (with MXstudio v2.4).
- Turbo Ring v2, Turbo Chain supports Port Trunking.

Enhancements

- CLI: Support Multiple Sessions (up to six).
- SMTP Supports Transport Layer Security (TLS) Protocol and Removes SSL v2/v3.
- SNMPv3 Traps and Informs.
- Display Issue with Java Applet.
- Fiber Check: Add Threshold Alarm.
- Static Port Lock with IVL Mode.
- When GbE Port Speed is [Auto], MDI/MDIX is [Auto] Fixed.
- Web UI/CLI Command Enhancement and Modification.

Bugs Fixed

- When the device received a large amount of BPDU packets on the port that did not enable the RSTP function, it sometimes caused the device to reboot.
- The '&' character in the column of the switch name, switch location, switch description in system info will not show on the how page information.
- When Turbo Chain was established on slot 9 it was not always stable.

Changes

- Removed the VEE indicator of the PoE function.
- Rate limit added more options on the ingress rate.

Notes

N/A



Version: v4.2	Build: Build_15062313
Release Date: N/A	

Applicable Products

ICS-G7752A-4XG-HV-HV

Supported Operating Systems

N/A

New Features

- Added new Multicast Fast Forwarding Mode.

Enhancements

- Increased IGMP Groups to 4096 (original 1000 groups).
- Improved Turbo Chain link status check mechanism at the head port.

Bugs Fixed

- Device rebooted when using CLI commands to back up the device configurations to the TFTP server.
- Device rebooted when using CLI commands to change SNMP v3 data encryption key and the length of key is over than 100 characters.

Changes

N/A

Notes

N/A



Version: v4.1	Build: Build_14091516
Release Date: N/A	

Applicable Products

ICS-G7752A-4XG-HV-HV

Supported Operating Systems

N/A

New Features

- First release for ICS-G7752A Series.

Enhancements

N/A

Bugs Fixed

N/A

Changes

N/A

Notes

N/A